## **Installation Instructions**

For set # 7.3118 00-03 NISSAN MAXIMA FRONT CONTROL ARM BUSHING



1131 VIA CALLEJON, SAN CLEMENTE, CA 92673

© 2004 Energy Suspension. All rights reserved. May not be reproduced, in any form, or by any means, without the written consent of Energy Suspension.

It is recommended that if you are unfamiliar with this type of work that you refer to a qualified service center specializing in this type of work. It is also recommended that if you choose to do this work yourself that a factory service manual be obtained for the proper procedures pertaining to removal, replacement and proper torque specifications for your vehicle. This instruction set is intended as a guideline for the safe installation of Energy Suspension's polyurethane bushings, once you have removed the factory components from your vehicle.

## PARTS LIST

4 ea 2395 Control Arm Bushing (front position)

2 ea 3447 Control Arm Bushing (rear position)


2 ea 15.10.384.39 Sleeve (1.000"x18mmX1.845")

4 ea 15.03.71.39 Washer (1.750"x18mmX0.125")

Press out O.E. outer metal shell from aluminum bracket, then press pivot pin on control arm out of bushing. A pressed fit sleeve will then need to be removed. Grease all metal parts that will touch bushing # 3447. Part numburs faces the rear.





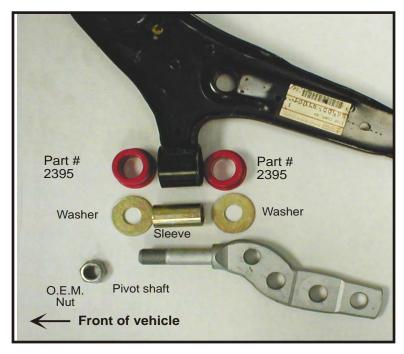



The sleeve will need to come off the rear pin. It's a tight press fit. With a hammer and chisel, make a groove along its length, this will relieve the press fit. The sleeve will then slide off by hand.